



## Electrical Diagram

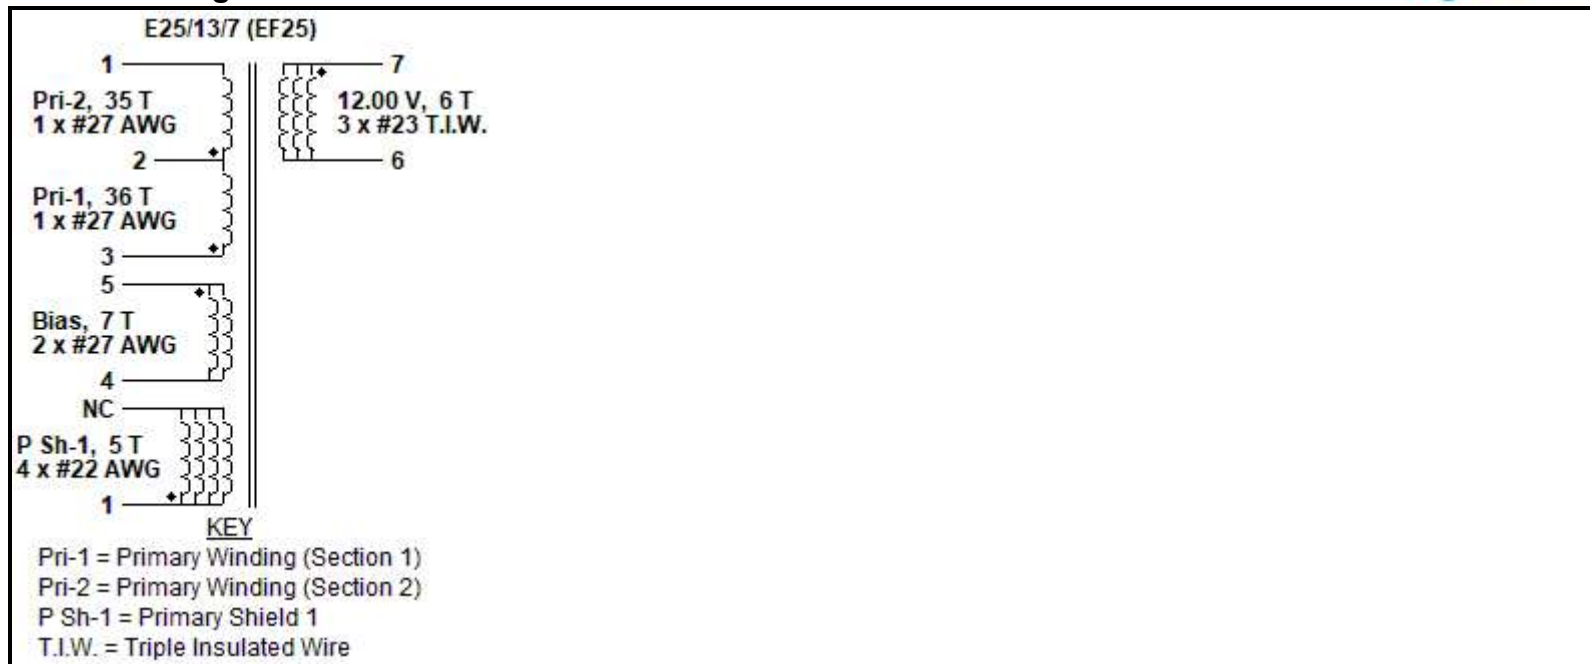

## Mechanical Diagram

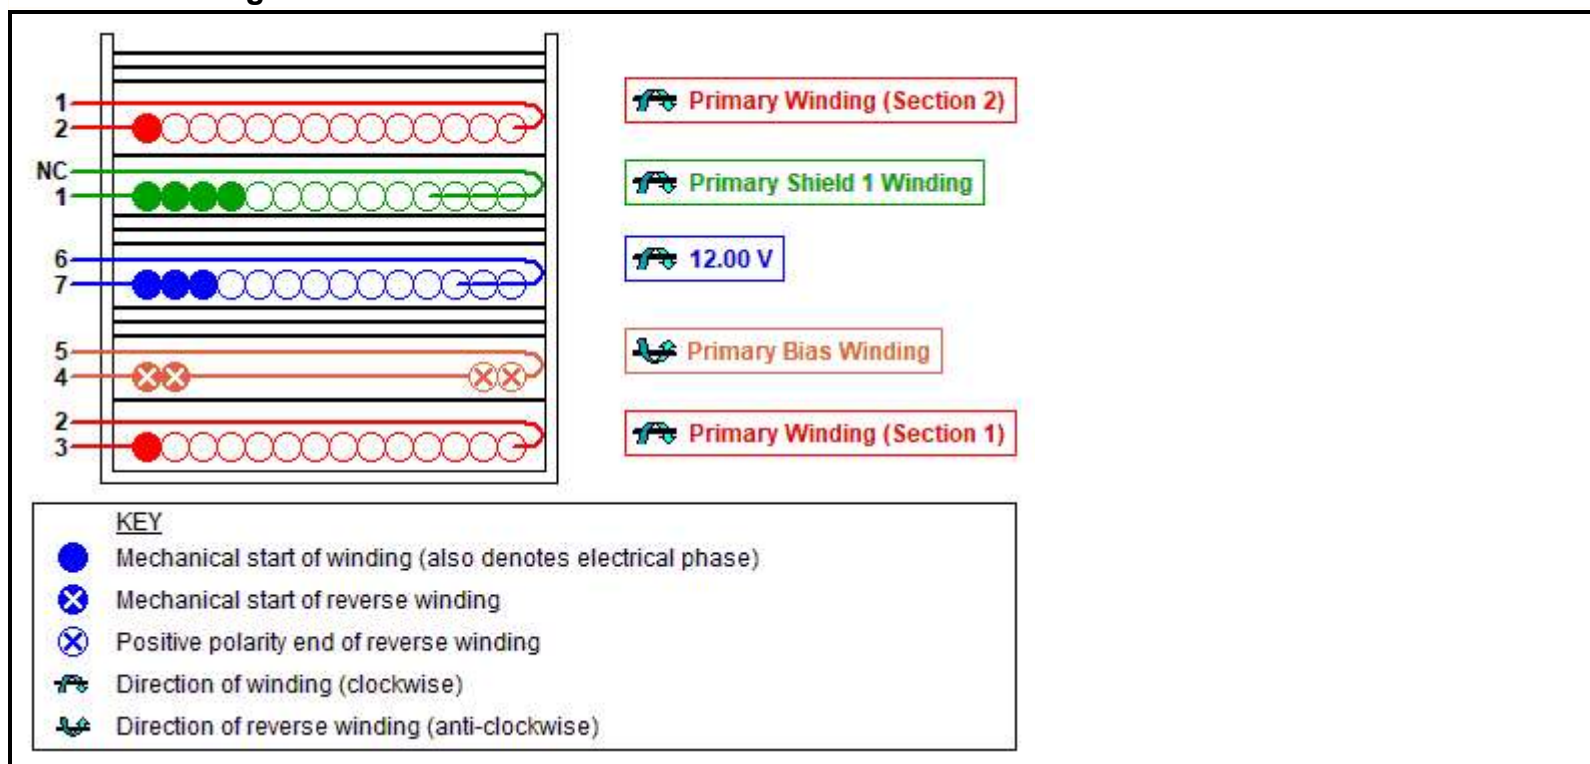

## Winding Instruction

### Primary Winding (Section 1)

Start on pin(s) 3 and wind 36 turns (x 1 filar) of item [5]. in 1 layer(s) from left to right. Winding direction is clockwise. On the final layer, spread the winding evenly across entire bobbin. Finish this winding on pin(s) 2.

Add 1 layer of tape, item [3], for insulation.

### Primary Bias Winding

Start on pin(s) 4 and wind 7 turns (x 2 filar) of item [5]. Winding direction is counter-clockwise. Spread the winding evenly across entire bobbin. Finish this winding on pin(s) 5.

Add 3 layers of tape, item [3], for insulation.

### Secondary Winding

Start on pin(s) 7 and wind 6 turns (x 3 filar) of item [6]. Spread the winding evenly across entire bobbin. Winding direction is clockwise. Finish this winding on pin(s) 6.

Add 3 layers of tape, item [3], for insulation.

### Primary Shield 1 Winding

Start on pin(s) 1 and wind 5 turns (x 4 filar) of item [7] from left to right in exactly 1 layer. Winding direction is clockwise. Spread the winding evenly across entire bobbin. Leave this end of primary shield winding not connected.

Add 1 layer of tape, item [3], for insulation.

### Primary Winding (Section 2)

Start on pin(s) 2 and wind 35 turns (x 1 filar) of item [5]. in 1 layer(s) from left to right. Winding direction is clockwise. On the final layer, spread the winding evenly across entire bobbin. Finish this winding on pin(s) 1.

Add 3 layers of tape, item [3], for insulation.

### Core Assembly

Assemble and secure core halves. Item [1].

### Varnish

Dip varnish uniformly in item [4]. Do not vacuum impregnate.

## Comments

1. Use of a grounded flux-band around the core may improve the EMI performance.

2. For non margin wound transformers use triple insulated wire for all secondary windings.

## Materials

Item	Description
[1]	Core: E25/13/7 (EF25), 3F3, gapped for ALG of 190 nH/T <sup>2</sup>
[2]	Bobbin: Generic, 5 pri. + 5 sec.
[3]	Barrier Tape: Polyester film [1 mil (25 µm) base thickness], 15.30 mm wide
[4]	Varnish
[5]	Magnet Wire: 27 AWG, Solderable Double Coated
[6]	Triple Insulated Wire: 23 AWG
[7]	Magnet Wire: 22 AWG, Solderable Double Coated

## Electrical Test Specifications

Parameter	Condition	Spec
Electrical Strength, VAC	60 Hz 1 second, from pins 1,2,3,4,5 to pins 6,7.	3000
Nominal Primary Inductance, µH	Measured at 1 V pk-pk, typical switching frequency, between pin 1 to pin 3, with all other Windings open.	959
Tolerance, ±%	Tolerance of Primary Inductance	5.0
Maximum Primary Leakage, µH	Measured between Pin 1 to Pin 3, with all other Windings shorted.	25.17

Although the design of the software considered safety guidelines, it is the user's responsibility to ensure that the user's power supply design meets all applicable safety requirements of user's product.

The products and applications illustrated herein (including circuits external to the products and transformer construction) may be covered by one or more U.S. and foreign patents or potentially by pending U.S. and foreign patent applications assigned to Power Integrations. A complete list of Power Integrations' patents may be found at [www.power.com](http://www.power.com).